Cutting parameters for PML/PM series end mills

PML-2B★PM-2B★PML-2BL★PM-2BL/M/X★ PML-2BFP★PM-2BFP(general cutting)

Workpiece material	Cast iron, Carbon steel, Alloy steel ~30HRC		Stainless steel		Pre-hardened steel, quenched and tempered steel ~40HRC		Pre-hardened steel, quenched and tempered steel ~50HRC		Hardened steel ~55HRC	
Diameter (mm)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)
R0.5	40000	960	22300	240	32000	385	25000	330	22280	295
R1.0	24000	1080	11150	275	16000	480	13000	330	11140	295
R1.5	15500	1150	7400	350	10600	545	8500	335	7430	295
R2.0	11500	1150	5550	445	8000	665	6500	450	5570	385
R2.5	9500	1270	4450	445	6400	665	5000	455	4455	405
R3.0	8000	1270	3700	470	5300	700	4200	470	3715	420
R4.0	6000	1575	2750	550	4000	850	3200	535	2785	465
R5.0	4800	1455	2200	520	3200	785	2500	535	2230	465
R6.0	4000	1330	1850	520	2650	740	2100	505	1855	450
R8.0	3000	1270	1350	455	2000	725	1600	455	1395	395
R10.0	2400	1150	1100	445	1600	675	1250	400	1115	360
Maximum cutting depth	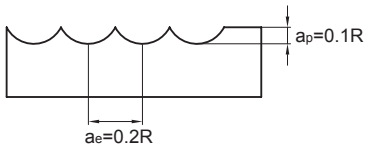									

1.Please select high-precision machine and tool holder.
2.Please use air blow or cutting liquid with high mist retardant property.
3.Down milling is recommended in the case of side milling.
4.When the machine rigidity and workpiece fixture stability is low, vibration and abnormal noise may be generated. Please reduce the rotating speed and feed speed stated above correspondingly.
5.Make overhang of tool as short as possible in conditions of non-interference.

PML-2B★PM-2B★PML-2BL★PM-2BL/M/X★ PML-2BFP★PM-2BFP(high speed cutting)

Workpiece material	Cast iron, Carbon steel, Alloy steel ~30HRC		Carbon steel, Alloy steel ~400HRC		Pre-hardened steel, quenched and tempered steel ~45HRC		Pre-hardened steel, quenched and tempered steel ~50HRC		Hardened steel ~55HRC	
Diameter (mm)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)	Rotating speed (min^{-1})	Feed speed (mm/min)
R3.0	15000	4800	11500	2750	9500	2250	7960	1885	6370	1510
R4.0	11500	3650	8950	2100	7150	1700	5970	1420	4775	1135
R5.0	9500	3000	7150	1700	5700	1350	4775	1130	3820	905
R6.0	7950	2500	5950	1400	4750	1100	3980	920	3180	735
R8.0	5950	1900	4450	1050	3550	850	2985	760	2390	610
R10.0	4750	1500	3550	850	2850	680	2390	570	1910	455
Maximum cutting depth	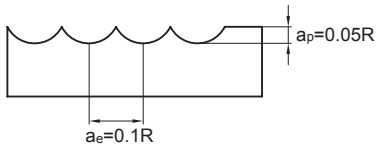									

1.Please select high-precision machine and tool holder.
2.Please use air blow or cutting liquid with high mist retardant property.
3.When the machine rigidity and workpiece fixture stability is low, vibration and abnormal noise may be generated. Please reduce the rotating speed and feed speed stated above correspondingly.
4.Make overhang of tool as short as possible in conditions of non-interference.